



# MG ZS

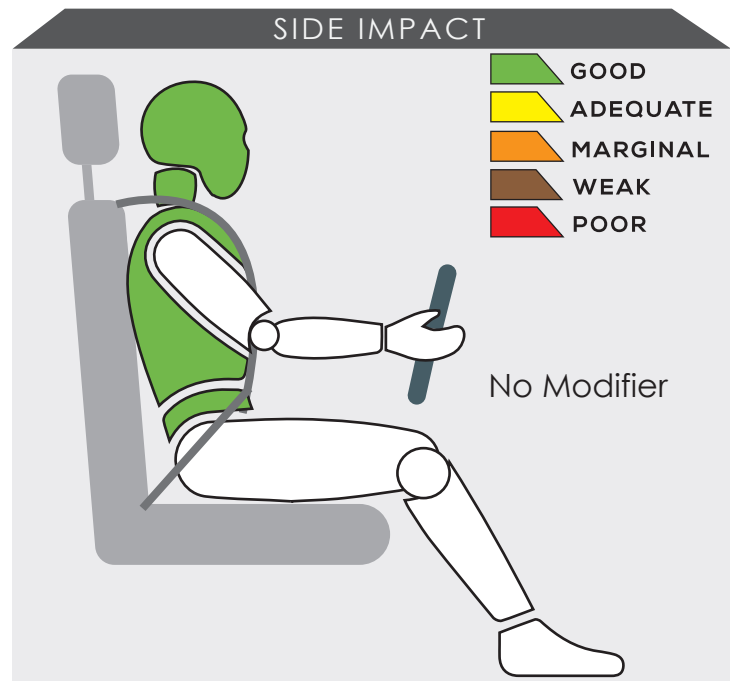

Variant <b>NEW MG ZS 1.5L C+</b>	Year Built <b>2020</b>
Model Year <b>2020</b>	Vehicle Category <b>SUV</b>
Engine Capacity <b>1.5 L</b>	Kerb Mass <b>1290 kg</b>
No. of Airbags <b>2</b>	Test Lab <b>CNTRC</b>

TESTED VARIANT ORIGIN	THAILAND	FOR	THAILAND, VIETNAM
OTHER ASEAN PRODUCTION (ALL VARIANTS)	THAILAND	FOR	THAILAND, VIETNAM

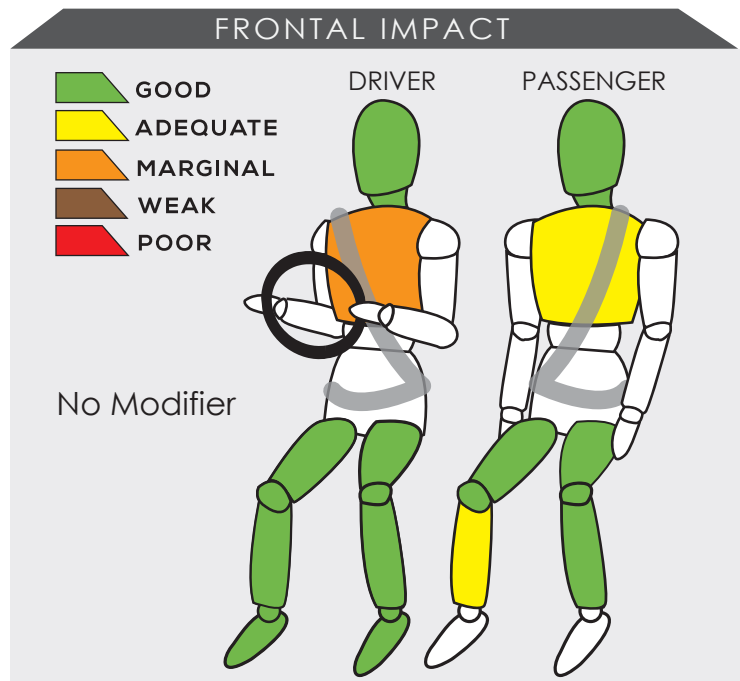

Data from the test showed the SUV provided good protection to the occupants with the vehicle remained stable in the frontal offset test. Nevertheless, there were marginal and adequate protection given to both of the occupants' chests.

The performance of HPT was confirmed with additional deployment test and its score was determined based on Fitment Rating System (FRS).

# SAFETY ITEMS (PASSIVE)

ITEMS		COUNTRIES										
Airbags	Driver	NS	NS	NS	NS	NS	NS	NS	NS	S	S	
	Passenger	NS	NS	NS	NS	NS	NS	NS	NS	S	S	
	Side (2)	NS	NS	NS	NS	NS	NS	NS	NS	O	O	
	Curtain (2)	NS	NS	NS	NS	NS	NS	NS	NS	O	O	
	Knee	NS	NS	NS	NS	NS	NS	NS	NS	X	X	
Seatbelts	Retractor Pre-tensioner & Load Limiter for Driver	NS	NS	NS	NS	NS	NS	NS	NS	S	S	
	Retractor Pre-tensioner & Load Limiter for Passenger	NS	NS	NS	NS	NS	NS	NS	NS	S	S	

S : Standard on all variants, O : Optional on base; Standard on higher variants, X : Not available, TBA : To be advised, NS : Not sold



### DYNAMIC TEST ASSESSMENT

18-MONTH-OLD CHILD		3-YEAR-OLD CHILD	
<b>Restraint</b>	: Britax Baby Safe Plus ISOFIX	<b>Restraint</b>	: Britax Duo Plus
<b>Facing</b>	: Rearward Facing	<b>Facing</b>	: Forward Facing
<b>Installation</b>	: ISOFIX & Supportleg	<b>Installation</b>	: ISOFIX & Top Tether
<b>Frontal Impact</b>	: 8.00	<b>Frontal Impact</b>	: 6.00
<b>Side Impact</b>	: 4.00	<b>Side Impact</b>	: 4.00
<b>Total Performance</b>	: 12.00	<b>Total Performance</b>	: 10.00

## CRS INSTALLATION ASSESSMENT

CRS	DIRECTION	SEAT POSITION						
		FRONT	2ND ROW			3RD ROW		
		PASSENGER	LEFT	CENTRE	RIGHT	LEFT	CENTRE	RIGHT
Maxi Cosi Cabriofix	Rwd	EXEMPT	PASS	PASS	PASS	N/A	N/A	N/A
Combi Malgot	Rwd	EXEMPT	PASS	FAIL	PASS	N/A	N/A	N/A
Combi Malgot	Fwd	PASS	PASS	FAIL	PASS	N/A	N/A	N/A
Combi Buon Junior Air	Fwd	FAIL	PASS	FAIL	PASS	N/A	N/A	N/A
Britax Baby Safe Plus ISOFIX Base	Rwd	EXEMPT	PASS	EXEMPT	PASS	N/A	N/A	N/A
Maxi Cosi Milofix	Rwd	EXEMPT	PASS	EXEMPT	PASS	N/A	N/A	N/A
Maxi Cosi Milofix	Fwd	EXEMPT	PASS	EXEMPT	PASS	N/A	N/A	N/A
Britax Duo Plus	Fwd	EXEMPT	PASS	EXEMPT	PASS	N/A	N/A	N/A
Britax KidFix XP	Fwd	PASS	FAIL	FAIL	FAIL	N/A	N/A	N/A
Britax Baby Safe Plus ISOFIX Base*	Rwd	EXEMPT	PASS	EXEMPT	PASS	N/A	N/A	N/A
Britax Duo Plus (ISOFIX)*	Fwd	EXEMPT	PASS	EXEMPT	PASS	N/A	N/A	N/A

PASS : Install without problem, FAIL : Safety critical problem, EXEMPT : Installation not allowed, N/A : Not available  
 \*Manufacturer's selection



